



Kay Ivey  
GOVERNOR

**ALABAMA**  
**DEPARTMENT OF TRANSPORTATION**

**AERONAUTICS BUREAU**  
**1409 COLISEUM BOULEVARD**  
**MONTGOMERY, ALABAMA 36110**  
PHONE (334) 242-6820  
FAX (334) 353-6540  
Internet: [www.dot.state.al.us](http://www.dot.state.al.us)



John R. Cooper  
TRANSPORTATION DIRECTOR

June 15, 2023

The Honorable Richard Phillips, Mayor  
City of Oneonta  
202 Third Avenue East  
Oneonta, Alabama 35121

**Subject: Annual Inspection Report**  
**Robbins Field Airport (20A)**

Dear Mayor Phillips:

An inspection of the Robbins Field Airport (20A) was conducted by personnel of the Alabama Department of Transportation Aeronautics Bureau on May 31, 2023. The purpose of the inspection was to update the information currently on file regarding the airport and to ascertain compliance with the rules and regulations of the Alabama Department of Transportation governing licensed public-use airports within the State of Alabama.

Attached you will find a copy of the Annual Inspection Report. As noted in the report, the airport meets the requirements for the issuance of an operating license. A signed license document will be mailed separately within a few weeks.

If you should have any questions concerning the inspection or corrective actions, please do not hesitate to contact Mr. Bennett Head with the Aeronautics Bureau at (334) 242-6831.

Frank Farmer  
Chief, Aeronautics Bureau

Copy: Mr. Rans Black, FAA/ADO  
Mr. Lorn Whittaker, FAA/ADO  
Ms. Natalie Hobbs, GMC  
Mr. Brandon Horton, Airport Manager

## Alabama Department of Transportation Aeronautics Bureau—Annual Airport Inspection Report

In accordance with the provisions of the Code of Alabama 23-1-357, an inspection of the **Robbins Field Airport (20A)** was conducted by **Mr. Bennett Head** with the Alabama Department of Transportation Aeronautics Bureau on **May 31, 2023**.

The inspection was conducted on the airport under the provisions of the Administrative Code Chapter 450-9-1 for the following areas:


Aeronautics Administrative Code	Inspection Results	Corrective Action	Notes
<b>Approach &amp; Departure Paths</b> Administrative Code 450-9-1-.12 (1)	<i>In Compliance</i> <i>Maintenance</i>	N/A	Penetrations to the FAA Part 77 surface were found on both Runway ends.
<b>Primary Surface</b> Administrative Code 450-9-1-.12 (2)	<i>In Compliance</i>	N/A	N/A
<b>Runway Safety Area</b> Administrative Code 450-9-1-.12 (3)	<i>In Compliance</i>	N/A	N/A
<b>Airport Markings</b> Administrative Code 450-9-1-.12 (4)	<i>In Compliance</i> <i>Maintenance</i>	Clean Runway markings. If markings are unable to be cleaned, remark in accordance with FAA AC 150/5340-1M.	Runway Markings have accumulated algae.
<b>Wind Direction Indicator</b> Administrative Code 450-9-1-.12 (5)	<i>In Compliance</i>	N/A	N/A
<b>Airport Lighting</b> Administrative Code 450-9-1-.12 (6)	<i>In Compliance</i> <i>Maintenance</i>	Replace or correct the inoperable lights.	Two Runway lights and two threshold lights are inoperable.
<b>Runway, Taxiway and Apron Conditions</b> Administrative Code 450-9-1-.12 (7)	<i>In Compliance</i>	N/A	N/A
<b>Fueling Area Requirements</b> Administrative Code 450-9-1-.12 (8)	<i>In Compliance</i>	N/A	There is no fuel service at this airport.
<b>Prohibited Activities</b> Administrative Code 450-9-1-.16	<i>In Compliance</i>	N/A	N/A
Additional Items	<i>In Compliance</i>	N/A	N/A

### *License Status—***COMPLIANCE**

The corrective actions that may be prescribed in this inspection report do not relieve the airport sponsor from compliance with any other Federal, State or local laws, ordinances or regulations that may be applicable. It is the responsibility of the airport sponsor to be aware of and obey all Federal, State or local laws, ordinances or regulations that may have a bearing on the corrective actions that may be specified in this report.

**Code of Alabama 23-1-357(a)**... a person or municipality may not operate an airport, restricted landing area, or other navigation facility without a license issued by this Department.

**May 31, 2023**

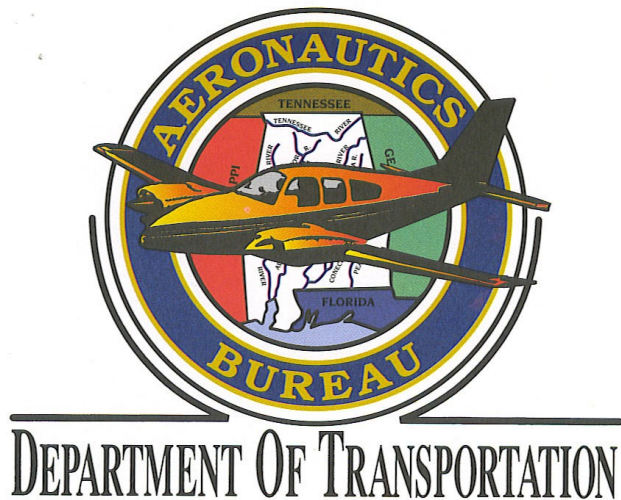

# **ANNUAL INSPECTION REPORT**



**ROBBINS FIELD AIRPORT (20A)  
ONEONTA, ALABAMA**

## Robbins Field Airport (20A)

### Approach and Departure Paths—RUNWAY 6

Administrative Code 450-9-1-.12(1)



No obstructions located in the ALDOT Approach/Departure Path of Runway 6. However, there were FAA part 77 penetrations found. Please see Appendix #2 for more information.



## Robbins Field Airport (20A)

### Approach and Departure Paths—RUNWAY 24

Administrative Code 450-9-1-.12(1)



No obstructions located in the ALDOT Approach/Departure Path of Runway 24. However, there were FAA part 77 penetrations found. Please see Appendix #3 for more information.



## Robbins Field Airport (20A)

### Primary Surface

Administrative Code 450-9-1-.12(2)



The Primary Surface **meets** state licensing standards.



## Robbins Field Airport (20A)

### Runway Safety Area

Administrative Code 450-9-1-.12(3)



Runway Safety Area **meets** state licensing standards.



## Robbins Field (20A)

### Airport Markings—Runway

Administrative Code 450-9-1-.12(4)



Runway markings are in **FAIR** condition.

**Maintenance Required:** Clean Runway markings. If markings are unable to be cleaned, remark in accordance with FAA AC 150/5340-1M.



## Robbins Field Airport (20A)

### Airport Markings—Taxiway

Administrative Code 450-9-1-.12(4)



Taxiway markings are in **GOOD** condition. Hold short marking is beginning to fade.

## Robbins Field Airport (20A)

### Airport Markings—Apron

Administrative Code 450-9-1-.12(4)



Apron markings are in **GOOD** condition.



## Robbins Field Airport (20A)

### Wind Direction Indicator

Administrative Code 450-9-1-.12(5)



Wind direction indicator is in **GOOD** condition.

## Robbins Field Airport (20A)

### Airport Lighting

Administrative Code 450-9-1-.12(6)

An inspection of the lighting system had the following results:

<b>Runway Lights</b>	2 inoperable
<b>Taxiway Lights</b>	0 inoperable
<b>Threshold Lights</b>	2 inoperable
<b>PAPI</b>	0 inoperable
<b>REIL</b>	0 inoperable

**MEETS** State Licensing Standards for night-time operation.



## Robbins Field Airport (20A)

### Runway, Taxiway and Apron Conditions—RUNWAY

Administrative Code 450-9-1-.12(7)



Runway surface is in **GOOD** condition.

## Robbins Field Airport (20A)

### Runway, Taxiway and Apron Conditions—TAXIWAY

Administrative Code 450-9-1-.12(7)



The Taxiway surface is in **GOOD** condition.



## Robbins Field Airport (20A)

### Runway, Taxiway and Apron Conditions—APRON

Administrative Code 450-9-1-.12(7)



Apron surface is in **GOOD** condition.

## Robbins Field Airport (20A)

### Fueling Area Requirements

Administrative Code 450-9-1-.12(8)



There is no fuel available at this airport.



## Robbins Field Airport (20A)

### Prohibited Activities


Administrative Code 450-9-1-.16



No prohibited activities were observed during this inspection.

# APPENDIX 1

Approach and Departure Path Dimensions			
Inner Width	Outer Width	Length	Acreage
250 Feet	450 Feet	1,000 Feet	8.04 Acres
Primary Surface Dimensions			
250 Feet Wide Centered Along Runway Centerline			
Extending 200 Feet Past the Runway End			
Runway Safety Area Dimensions			
120 Feet Wide Centered Along Runway Centerline			
Extending 200 Feet Past the Runway End			

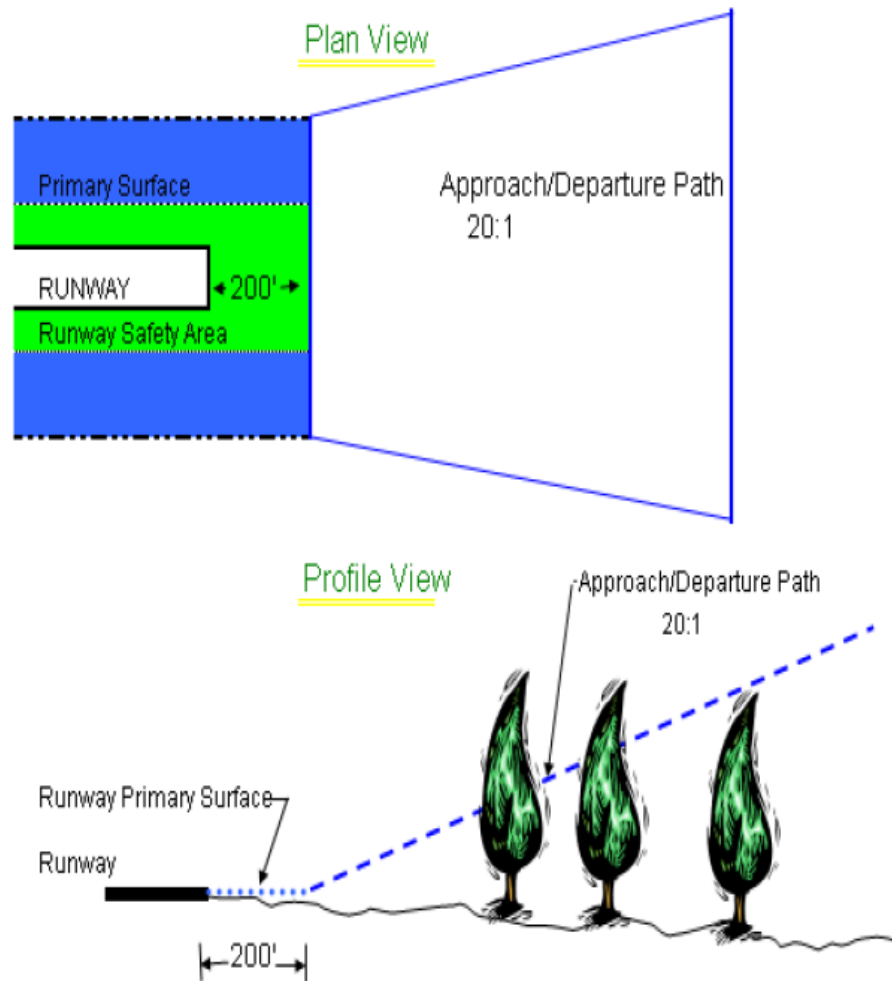



APPENDIX #2

ROBBINS FIELD AIRPORT  
ONEONTA, AL  
MAY 31, 2023  
RUNWAY 6 OBSTRUCTION EVALUATION

1. Hill 30' Abv. Rwy  
703' From Rwy End  
308' Right of CL  
16:1 Obst. Clrnc

3. Tree 82' Abv. Rwy  
1,183' From Rwy End  
300' Left of CL  
11:1 Obst. Clrnc

4. Tree 91' Abv. Rwy  
1,013' From Rwy End  
108' Left of CL  
8:1 Obst. Clrnc

5. Tree 89' Abv. Rwy  
529' From Rwy End  
233' Left of CL  
3:1 Obst. Clrnc



○ Penetrates FAA Part 77 Approach path  
But NOT an ALDOT violation.  
● Controlling Obstruction




ROBBINS FIELD AIRPORT  
ONEONTA, AL  
MAY 31, 2023  
RUNWAY 24 OBSTRUCTION EVALUATION

2. Tree 44' Abv. Rwy  
554' From Threshold  
296' Right of CL  
5:1 Obst. Clrnc

3. Tree 45' Abv. Rwy  
942' From Threshold  
305' Right of CL  
14:1 Obst. Clrnc

4. Tree 16' Abv. Rwy  
789' From Threshold  
63' Left of CL  
30:1 Obst. Clrnc

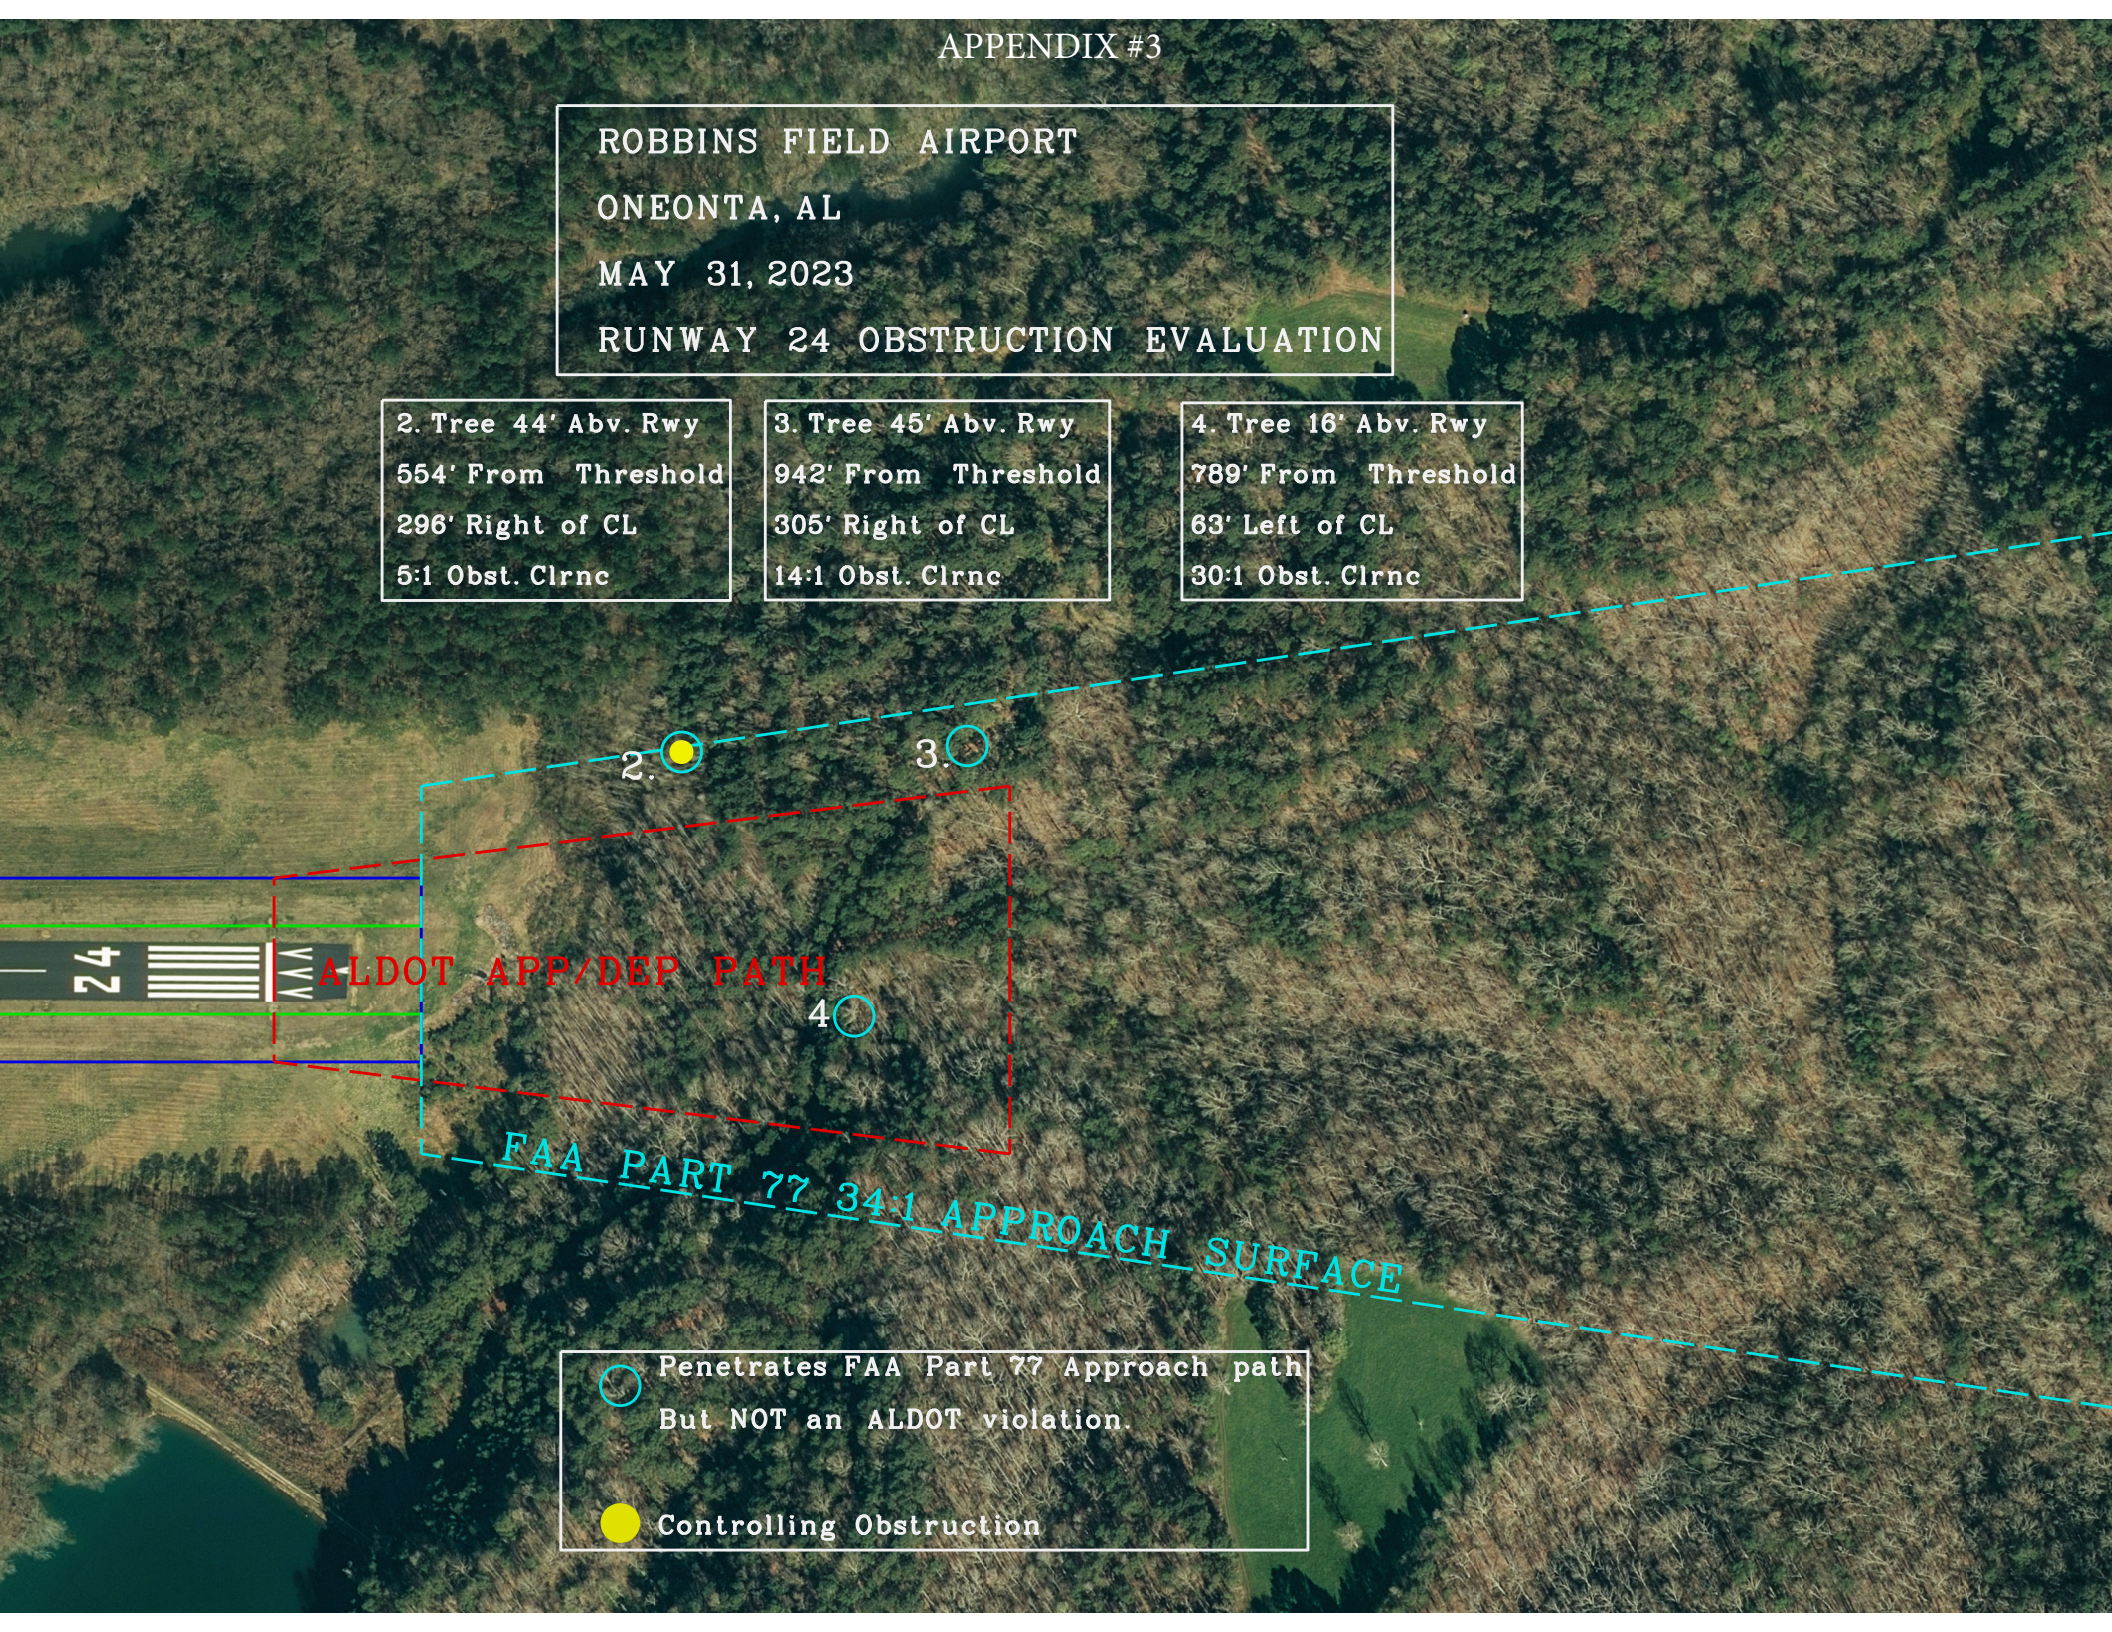

2.

3.

4.

ALDOT APP/DEP PATH

FAA PART 77 34-1 APPROACH SURFACE

○ Penetrates FAA Part 77 Approach path  
But NOT an ALDOT violation.

● Controlling Obstruction