



Bob Riley
GOVERNOR

ALABAMA
DEPARTMENT OF TRANSPORTATION

AERONAUTICS BUREAU
1409 COLISEUM BOULEVARD
MONTGOMERY, ALABAMA 36110

PHONE (334) 242-6820
FAX (334) 353-6540



Joe McInnes
TRANSPORTATION DIRECTOR

July 2, 2007

Mr. Jim Zessin
Floralia Airport Authority
P. O. Box 76
Floralia, Alabama 36442

Subject: Annual Inspection Report
Floralia Municipal Airport

Dear Mr. Zessin:

An inspection of the Floralia Municipal Airport was conducted by personnel of the Alabama Department of Transportation Aeronautics Bureau on June 19, 2007. The purpose of the inspection was to update the information currently on file regarding the airport and to ascertain compliance with the rules and regulations of the Alabama Department of Transportation governing licensed public-use airports within the State of Alabama.

Attached you will find a copy of the Annual Inspection Report for the Floralia Municipal Airport. As noted in the report, the airport **does not** meet the requirements for the issuance of an operating license. The operating license for the airport is being withheld pending the required actions necessary to correct the safety deficiencies. The Code of Alabama 23-1-375 prohibits the operation of an airport for which a license has not been issued. Once the deficiencies have been corrected, contact the Aeronautics Bureau to schedule a re-inspection to determine if the airport's operating license can be issued. Failure to comply with the licensing requirements could result in a mandatory closure of the entire airport.

If you should have any questions concerning the inspection or corrective actions, please do not hesitate to contact the Aeronautics Bureau at (334) 242-6820.

Sincerely,

John C. Eagerton IV, D.P.A.
Chief, Aeronautics Bureau

Copy: Mr. Rans Black
FAA/ADO

Annual Inspection Report Floralia Municipal Airport Floralia, Alabama

June 19, 2007

Introduction:

Code of Alabama 23-1-357(c). The department may perform such acts, issue and amend such orders and make, promulgate, or amend general or special rules, regulations, and procedures and establish minimum standards, consistent with the provisions of this article as it shall deem necessary to carry out the provisions of this article and to perform its duties hereunder, all commensurate with and for the purpose of protecting and insuring the general public interest, health, welfare, and safety. (Act 2000-220, 10.)

In accordance with the provisions of the Code of Alabama 23-1-357(c) an inspection of the Floralia Municipal Airport was conducted by Mr. Kline Jeffcoat of the Alabama Department of Transportation Aeronautics Bureau on June 19, 2007.

The corrective actions that may be prescribed in this inspection report do not relieve the airport owner from compliance with any other Federal, State or local laws, ordinances or regulations that may be applicable. It is the responsibility of the airport owner to be aware of and obey all Federal, State or local laws, ordinances or regulations that may have a bearing on the corrective actions that may be specified in this report.

Inspection Methodology:

The inspection of the required State Approach/Departure Path and Federal Runway Protection Zones was accomplished by the use of approved engineering methods and equipment. The angles, locations and heights of trees or other objects within these areas were derived by the use of a Theodolite and electronic distance measuring device.

All other areas of the inspection were conducted visually and photographed for reference purposes.

License Status:

Code of Alabama 23-1-375(a). ...a person or municipality may not operate an airport, restricted landing area, or other air navigation facility without a license issued by the department.

Annual Inspection Report Floralá Municipal Airport Floralá, Alabama

June 19, 2007

Based upon the findings of the inspection conducted on June 19, 2007, it was determined that the airport ***does not*** meet the requirements for the issuance of an operating license.

The inspection was conducted on the airport under the provisions of the Administrative Code for the following areas:

Approach and Departure Paths - Administrative Code 450-9-1-.12(1) (See Appendix 1)

State Licensing Standards

- For all hard surface runways the approach and departure path begins 200 feet from the runway end (runway threshold).
- The approach and departure path for all runways is centered along the extended runway centerline and extends for 1000 feet.
- The approach and departure path for all runways slopes up at a ratio of 20:1.
- All penetrations of the approach and departure paths, whether natural or manmade, constitute an obstruction to navigation and must be removed.
- The land beneath the approach and departure path must be controlled by the airport owner. This is accomplished by ownership of the property in fee simple or by written perpetual agreement with the owner of the land.

Inspection Results

- The approach and departure paths for each end of Runway 4/22 were inspected with the following violations found:
- **Violation:** Runway 4 – A tree identified as Tree # 1 obstructs the approach/departure path of runway 4 (See Photo # 1 & Appendix 2).

Annual Inspection Report Floralá Municipal Airport Floralá, Alabama

June 19, 2007

Photo #1 – Runway Approach / Departure Violation



Required Action:

- While this tree is representative of obstructions in the approach departure path of runway 4 it may not include all the trees that violate the 20:1 approach departure path.
- In order for an operating license to be issued the obstructions to runway 4 must be removed.

Primary Surface - Administrative Code 450-9-1-.12(2)

State Licensing Standards

- Primary Surface (See Appendix 1): The primary surface is 250 feet wide, centered on the runway centerline and extends 200 feet past the end of the marked runway. The primary surface is required to be free of all obstructions, manmade or natural. The only allowable objects are runway lights, guidance signs, or navigation equipment that by function is required to be within the primary surface boundaries.

Annual Inspection Report Floralá Municipal Airport Floralá, Alabama

June 19, 2007

Inspection Results

- The primary surface was inspected and found to meet state requirements.

Runway Safety Area - Administrative Code 450-9-1-.12(3)

State Licensing Standards

- Runway Safety Area (Appendix 1): All runways are required to maintain an obstruction free area adjacent to each runway. This area is 120 feet wide, centered on the runway centerline, and extends for a distance of 200 feet past the runway end. The area must be compacted and graded smooth with no ruts, humps, depressions or other potentially hazardous surface variations. The slope along the longitudinal centerline shall not exceed a rise or fall of three percent in elevation relative to the runway end elevation. The lip from the top of the pavement to the grade adjacent to the runway should not exceed 3 inches.

Inspection Results

- The grade of the runway safety area was found to be in compliance with the State's licensing standards

Airport Markings - Administrative Code 450-9-1-.12(4)

State Licensing Standards

- Airport Markings: All runways are required to be marked in a manner identifying the boundaries of the landing areas. The runway markings must be painted white and be maintained in a legible condition.

Inspection Results

- The runway markings are in fair condition.

Annual Inspection Report Floralá Municipal Airport Floralá, Alabama

June 19, 2007

Wind Direction Indicator - Administrative Code 450-9-1-.12(5)

State Licensing Standards

- Wind Direction Indicators: All airports are required to have an operational wind direction indicator. It must be installed in a highly visible area and free from obstructions to ensure true wind direction and velocity. Night operations require the indicator be lighted.

Inspection Results

- The wind direction indicator (windsock) was inspected and complies with standards.

Airport Lighting - Administrative Code 450-9-1-.12(6)

State Licensing Standards

- Airport Lighting: Runway lights and airport rotating beacons and a lighted wind direction indicator are required for night operations. All runway, threshold, and taxiway lighting shall be maintained in operational condition and shall not be obscured by natural growth such as grass and/or weeds.

Inspection Results

- The airport lighting system was inspected and all appeared to be in working order.

Runway, Taxiway and Apron Conditions - Administrative Code 450-9-1-.12(7)

State Licensing Standards

- Runway, Taxiway and Apron Conditions: All airport pavement surfaces associated with aircraft operations must be kept smooth and free of any defect or obstruction that could damage an aircraft. The lip of the airport pavement surfaces must not exceed three (3) inches in elevation from the top of the pavement to the shoulder. The drop should only be enough to allow sufficient drainage and not pose a control problem for aircraft exiting

Annual Inspection Report Floralá Municipal Airport Floralá, Alabama

June 19, 2007

the runway. The aircraft parking apron is for the operation and parking of aircraft only and should be smooth and free of obstructions or defects that could cause damage to aircraft during operations.

Inspection Results

- The airport pavement surfaces are in good condition.

Fueling Area Requirements - Administrative Code 450-9-1-.12(8)

State Licensing Standards

- Signs should be posted prohibiting open flames or smoking in fueling areas. The fueling facility must be labeled indicating the type fuel being dispensed.
- Grounding cables must be available.
- A fire extinguisher approved for the purpose of extinguishing petroleum product fires available during all fueling operations.
- Serviceable hoses and connections that would preclude a rupture or leaking of fuel.

Inspection Results

- The fueling area meets the requirements established by the Alabama Department of Transportation. However, the State of Alabama Department of Agriculture and Industries may have additional requirements for fueling systems that were not considered during this inspection.

Prohibited Activities - Administrative Code 450-9-1-.16

State Licensing Standards

- Prohibited Activities: The use of any portion of the aircraft operations area, or airport property within the boundaries of the imaginary surfaces of a licensed airport for any purpose other than the operation of aircraft shall be deemed a non-aeronautical activity and is prohibited.

Annual Inspection Report Floralá Municipal Airport Floralá, Alabama

June 19, 2007

Inspection Results

- No prohibited activities were observed during this inspection.

Summary

The table below summarizes items noted in this report.

INSPECTION SUMMARY

Inspection Area	Violation/Maintenance	Corrective Action
Runway 4 Approach and Departure Path	Violation	Clear trees obstructing the approach and departure path.


Included with this report is an airport safety self-inspection checklist. This checklist is taken from FAA Advisory Circular (AC) 150/5200-18C and should be used in accordance with this AC to develop your own self-inspection program.

Please contact the Aeronautics Bureau of the Alabama Department of Transportation at (334) 242-6820 with questions concerning the Annual Inspection Report.

Annual Inspection Report Floralia Municipal Airport Floralia, Alabama

June 19, 2007

Approach and Departure Path Dimensions			
Inner Width	Outer Width	Length	Acreage
250 Feet	450 Feet	1,000 Feet	8.04 Acres
Primary Surface Dimensions			
250 Feet Wide Centered Along Runway Centerline			
Extending 200 Feet Past the Runway End			
Runway Safety Area Dimensions			
120 Feet Wide Centered Along Runway Centerline			
Extending 200 Feet Past the Runway End			

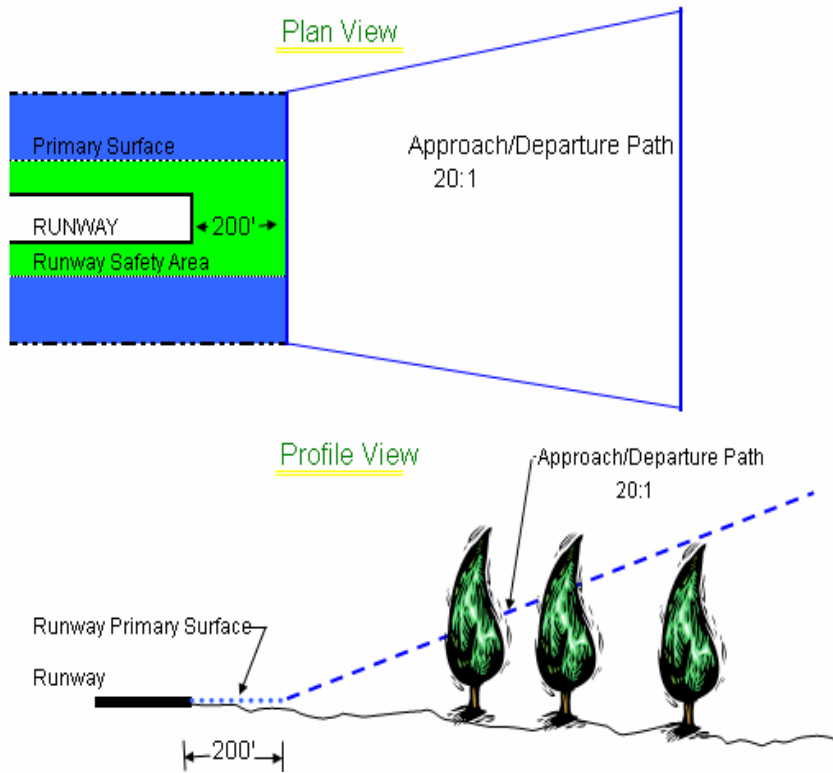

APPENDIX 1